



# **MINIMAT-EC-Servo Screwdriver Spindles**

Maximum Flexibility and Process Control Straight Spindle Form - Torque range from 0.2 Nm - 500 Nm Angle Head Design - Torque range from 5 Nm - 70 Nm

- powerful
- flexible
- high precision
- full documentation capability

MINIMAT-EC-Servo screwdriver spindles in connection with the sequence controller AST40 allow free programming of the screw tightening process and offer maximum flexibility, accuracy and process control. Torque, speed, angle, drive direction and sequence delay times can be customized to the individual screwdriving task within the power range of the selected screwdriver spindle. The integrated torque and angle sensor module employs non contact signal transmission techniques and enables precise control of the screwdriving process as well as the documentation of the screwdriving results and process parameters and also guarantees the highest shut-off accuracy.

The EC-Servo screwdriver is suitable for applications with the most demanding quality requirements – where direct measurement and control methods are required.



## **ADVANTAGES** 2

- High power density
- High shut-off accuracy
- Flexible
- Noise immunity
- **Comprehensive documentation options**
- System diagnostics
- Extensive integration and control options

The application of a brushless servomotor with high power density is essential to the maintenance free operation of the EC drive. It also delivers excellent dynamics and high peak torque in a compact form – ideally suited to the screw tightening process.

The DEPRAG screwdrivers based on EC technology enable a torque accuracy of < 1% standard deviation, which can be relied upon after millions of cycles.

Thus, a Cmk value of ≥1.67 with a tolerance requirement of ±5% in reference to 6 Sigma is reached. A Cmk value of 1.67 means that the error rate is less than 0.6 per one million screw assemblies.

The screwdriving system consists of the EC screwdriver spindle, AST40 screwdri-

ver sequence controller and a single connection cable that has been tested for extreme loading conditions. The single connection cable services the power and signal transmission functions between the screwdriver and controller using digital technology as most suitable for longer cable lengths.

## **DEPRAG SCREWDRIVING CONTROLLER AST40/ASTi40**

- Torque range: 0.2 500 Nm
- For MINIMAT-EC-SERVO screwdriver spindles
- Number of multi-level screw sequences: 120
- Documentation options: internal storage, output via RS232 or Ethernet (Datalogger), printer interface
- PLC interface: input/output, Profibus, Profinet, EtherCAT, EthernetIP



touch display

ASTi40 for installation into a switch cabinet

The sequence controller AST40/ASTi40 is a controller with integrated power supply. Within the performance range of each spindle torgue, speed, waiting period and rotational direction can be individually customized to the screw assembly task.

Extensive programming, control and documentation interfaces offer maximum flexibility for integration into existing process environments. Several communication options include input/output, various field bus interface options and an integrated web server for online screwdriver program configuration, data backup and screwdriver graph analysis via Ethernet.

All common screw assembly sequence programs are embedded in the AST40 screwdriver controller in the form of commands with parameters. Commissioning of an application can be completed in just a few steps. All required programming and setup functions are made available through the web interface so that no additional software is required, only a PC with a browser.

When choosing the option ASTi40 for integration into the switch cabinet, the software panel DAST is required for operation and visualisation of the controller. In that case the system controller additionally provides the range of functions available on the AST40 display.

## EC-SERVO SCREWDRIVER SPINDLE





For assembly in confined spaces.

## SYSTEM COMPONENTS


MINIMAT-EC-Servo, straight spind	size 27 with quick change chuck				
		<b>311E27-0010</b> 413400A	<b>311E27-0020</b> 413400B	<b>311E27-0050</b> 413400C	<b>311E27-0120</b> 413400E
Screwdriver with redundant measuring system for torque and angle	<b>Type</b> Part no.	<b>311ER27-0010</b> 101624A	<b>311ER27-0020</b> 101624B	<b>311ER27-0050</b> 101624C	<b>311ER27-0120</b> 101624E
Torque min. Torque max.	Nm/in.lbs Nm/in.lbs	0.2 / 1.77 1 / 8.85	0.4 / 3.54 2 / 17.7	1 / 8.85 5 / 44.25	2.4 / 21.24 12 / 106.2
Speed min.	rpm	100	60	40	20
Speed max. Diameter	rpm mm/in.	1600 27 / 1.05	1500 27 / 1.05	800 27 / 1.05	400 27 / 1.05
Length 311E/311ER	mm/in.	360/14.05 / 433/16.9	360/14.05 / 433/16.9	360/14.05 / 433/16.9	360/14.05 / 433/16.9
Weight 311E / 311ER	kg/lbs	1.2/2.64 / 1.4/3.1	1.2/2.64 / 1.4/3.1	1.2/2.64 / 1.4/3.1	1.2/2.64 / 1.4/3.1
Noise level	dB(A)	68	68	68	68
Internal hex. drive DIN ISO 1173		F6.3	F6.3	F6.3	F6.3
Suitable tool inserts and connecting components with a drive as per DIN ISO 1173		E6.3	E6.3	E6.3	E6.3

MINIMAT-EC-Servo, straight spindle form			size 36 with quick change chuck		
Screwdriv	er	<b>Type</b> Part no.	<b>311E36-0150</b> 205000A	<b>311E36-0300</b> 205000C	<b>311E36-0500</b> 205000D
Screwdrive for torque a	er with redundant measuring system and angle	<b>Type</b> Part no.	<b>311ER36-0150</b> 108717A	<b>311ER36-0300</b> 108717C	<b>311ER36-0500</b> 108717D
	rer with integrated off-set gearing e the center distance)	<b>Type</b> Part no.	<b>311E36-0160-SV1 **)</b> 104472A	-	-
Torque min	. 311E / 311ER 311E36-0160-SV1	Nm/in.lbs	3 / 26.55 3.2 / 28.32	6 / 53.1	10 / 88.5
Torque max	x. 311E / 311ER 311E36-0160-SV1	Nm/in.lbs	15 / 132.75 *) 16 / 141.6 *)	30 / 265.5 *)	50 / 442.5 *)
Speed min	•	rpm	50	30	20
Speed max	κ.	rpm	1000	600	380
Diameter		mm/in.	36 / 1.4	36 / 1.4	36 / 1.4
Length	311E / 311ER 311E36-0160-SV1	mm/in.	473/18.45 / 575/22.42 487/19	476/18.56 / 578/22.54	476/18.56 / 578/22.54
Weight	311E / 311ER 311E36-0160-SV1	kg/lbs	2.8/6.2 / 3.2/7.04 3.6/7.92	2.8/6.2 / 3.2/7.04	2.8/6.2 / 3.2/7.04
Noise level		dB(A)	62	62	62
Internal hex	k. drive DIN ISO 1173		F6.3	F11.2	F11.2
	ol inserts and connecting ts with a drive as per DIN ISO 1173		E6.3	E11.2	E11.2

\*) With a voltage below 180V the maximum torque will be reduced to 80% of the specified value.
\*\*) For assembly in confined spaces.

MINIMAT-EC-Servo, straight spindle form		size 42 with qui	ck change chuck	size 63			
Screwdriver Type Part no.		<b>311E42-0300</b> 206000B	<b>311E42-0800</b> 206000D	<b>311E63-1800</b> 416400D	<b>311E63-3500</b> 416400F	<b>311E63-5000</b> 416400H	
	ver with redundant measuring system	<b>Type</b> Part no.	<b>311ER42-0300</b> 101625B	<b>311ER42-0800</b> 101625D	<b>311ER63-1800</b> 107200D	<b>311ER63-3500</b> 107200F	<b>311ER63-5000</b> 107200H
Torque mi Torque ma		Nm/in.lbs Nm/in.lbs	6 / 53.1 30 / 265.5	16 / 141.6 80 / 708	36 / 318.6 180 / 1593	70 / 619.5 350 / 3097.5	100 / 885 500 / 4425
Speed mir		rpm	50	20	15	10	10
Speed ma Diameter	ЭХ.	rpm mm/in.	890 42 / 1.64	330 42 / 1.64	300 63 / 2.46	155 63 / 2.46	90 63 / 2.46
Length	311E / 311ER	mm/in.	478/18.64/81/22.66			617/24.06/745/29.1	617/24.06/745/29.1
Weight Noise leve	311E / 311ER əl	kg/lbs dB(A)	4.2/9.24 / 5/11 66	4.2/9.24 / 5/11 66	12.9/28.38 / 15/33 73	12.9/28.38 / 15/33 73	12.9/28.38 / 15/33 73
	ex. drive DIN ISO 1173 square drive DIN 3121		F11.2 -	F11.2 -	- F20 (3/4")	- F20 (3/4")	- F20 (3/4")
with a driv	ve as per DIN ISO 1173 ve as per DIN ISO 1173 ve as per DIN 3121		E11.2	E11.2	- H20 (3/4")	- H20 (3/4")	H20 (3/4")

## SYSTEM COMPONENTS

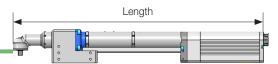

311EW36-0700-F12.5

108121C

14 / 123.9

70/619.5

## MINIMAT-EC-Servo, angle head design size 36 Screwdriver 311EW36-0220-F10 311EW36-0420-F10 Туре Part no. 108121A 108121B Torque min. 9 / 79.65 Nm/in.lbs 5/44.25 Torque max. Nm/in.lbs 22 / 194.7 42/371.7 35 20 Speed min. rpm

Speed min.	rpm	35	20	10	
Speed max.	rpm	650	350	200	
Diameter	mm/in.	36 / 1.4	36 / 1.4	36 / 1.4	
Length	mm/in.	554 / 21.6	554 / 21.6	557.5 / 21.74	
Weight	kg/lbs	4.8 / 10.56	4.8 / 10.56	5.1 / 11.22	
Noise level	dB(A)	68	62	62	
External square drive DIN 3121		F10	F10	F12.5	
Suitable tool inserts and connecting con with a drive as per DIN 3121	mponents	G10	G10	G12.5	

## **Optional Accessories**

Machine Capability Study Torque *)	Part no.	000717	<ul> <li>Evaluation of 50 measured values</li> <li>Idle speed, Average</li> </ul>		
Machine Capability Study Torque angle *)	Part no.	000718	- Idle speed, Average - Standard deviation, Cm-Value, Cmk-Value		
*) Additional services, e.g. calibration of screwdrivers, can be found in our catalog D3330E					

 Motor Cable
 Length
 Part no.

 5 m/16.4 ft (standard)
 8337252

 8 m/26.2 ft
 8337253

 12 m/39.4 ft
 8337254

The screwdriver spindles size 27 and type 311E36-0150 (size 36) can also be delivered with an automatic screw feed system. Please contact us for more information!

Sequence Controller		A	ST40	AS	STi40
for screwdriver		311E(R)27/36/42 311EW36	311E(R)63	311E(R)27/36/42 311EW36	311E(R)63
Sequence controller	Туре	AST40-1	AST40-2	ASTi40-1	ASTi40-2
Basic version with input/output interface	Part no.	385588A	387022A	428006A	387044A
Sequence controller	Туре	AST40-1 PB	AST40-2 PB	ASTi40-1 PB	ASTi40-2 PB
with fieldbus module Profibus port	Part no.	385588B	387022B	428006B	387044B
Sequence controller	Туре	AST40-1 PN	AST40-2 PN	ASTi40-1 PN	ASTi40-2 PN
with fieldbus module Profinet port	Part no.	385588C	387022C	428006C	387044C
Sequence controller	Туре	AST40-1 EC	AST40-2 EC	ASTi40-1 EC	ASTi40-2 EC
with fieldbus module EtherCAT port	Part no.	385588D	387022D	428006D	387044D
Sequence controller	Туре	AST40-1 E/IP	AST40-2 E/IP	ASTi40-1 E/IP	ASTi40-2 E/IP
with fieldbus module EtherNet/IP port	Part no.	385588E	387022E	428006E	387044E
Sequence controller	Туре	AST40-1 RS232	AST40-2 RS232	ASTi40-1 RS232	ASTi40-2 RS232
with interface AST40 RS232 for data output, format programmable via	Part no. web page	385588F	387022F	428006F	387044F
Technical data:					
Power unit (AC)	V / Hz	100 - 240	/ 50/60	100 - 240	/ 50/60
Insulation		IP54		IP54	
TFT-display (touch)		7", 800x480	)	-	
24V input/output interface		27 inputs / 3	80 outputs	27 inputs / 3	30 outputs
Dimensions (W x H x D)	mm / in.	232 x 315 x	205 / 9.05 x 12.3 x 8	232 x 315 x	205 / 9.05 x 12.3 x
Weight	kg / Ibs	approx. 13 /	28.6	approx. 13 /	28.6
Number of screwdriving programs					
(start via I/O interface or fieldbus)	d via http	120		120	
Number of screwdriving programs created	μ νια πιιρ	unlimited		unlimited	
Included in delivery					
Patch cable (connection cable ASTi40-PC)	Part no.	-		831902	
				DPU110 or DPU2	
Required accessories		-			cal data and further
				details in our broch	nure D3350E.

## SYSTEM COMPONENTS

## **Required Accessories**

Power supply cable	Length 1.8 m/5.9 ft	(EU)	Part no.	385443A
Power supply cable	Length 1.8 m/5.9 ft	(USA)	Part no.	385443B
Power supply cable	Length 1.8 m/5.9 ft	(Brazil)	Part no.	385443D
Power supply cable	Length 2.5 m/8.2 ft	(China)	Part no.	385443C

Optional accessories suitable for controller	Туре	AST40	ASTi40
Table stand	Part no.	300085A	-
Patch cable 2 m	Part no.	831902	_
ASTi40 reset plug	Part no.	-	425080A
Touch pen	Part no.	832190	_
Bus cable Length 2 m/6.56 ft, IP68 RJ45 - open wires (no connector) Cat.6	Part no.	138689	138689
Bus cable Length 5 m/16.4 ft, IP68 RJ45 - open wires (no connector) Cat.6	Part no.	138690	138690
Bus cable Length 2 m/6.56 ft, IP68 RJ45 - RJ45 Cat.6	Part no.	138685	138685
Bus cable Length 5 m/16.4 ft, IP68 RJ45 - RJ45 Cat.6	Part no.	138686	138686
Bus cable Length 2 m/6.56 ft, IP68 RJ45 - IP68 RJ45 Cat.6	Part no.	138687	138687
Bus cable Length 5 m/16.4 ft, IP68 RJ45 - IP68 RJ45 Cat.6	Part no.	138688	138688

## **Optional Additional Software**

Interface Graph Loader (hardware and software)	Part no.	385834A
Connection cable (AST40 - Graph Loader)	Part no.	385835D
Software ASTxx Serial Remote (activation key)		
for the simple storage of screwdriving curves and	Part no.	206565
result-data to a PC		
Software Datalogger (activation key)	Part no.	202699
Software Friction value screwdriving (activation key)	Part no.	201820
Software DEPRAG Clamp Force Control - DEPRAG CFC (activation key)	Part no.	109108
Software Statistics (activation key)	Part no.	206081
Software Graph Viewer for sequence controller AST (activation key)	Part no.	128901
Software Deprag Data eXchange for sequence controller AST (activation key)	Part no.	132680
Software TIA Link (activation key)	Part no.	135839
Software TwinCAT Link (activation key)	Part no.	140996

For more details to the software products, please see brochure D3900E.

1

Our software solutions undergo continuous improvements. We recommend that you regularly update your software. In this way you will always receive the most up-todate security updates, upgraded features and drivers. With the most current version of the software you can be sure that your device is optimally prepared for Industry 4.0.



6

# guide connection

## Handle with quick change chuck

For EC-Servo screwdriver sp	indles	311E27-xxxx	311E36-0150	311E36-0300 311E36-0500
Handle	Part no.	425800A	425900A	425900B
Internal hex. drive DIN ISO 1173		F6.3	F6.3	F11.2

## Handle with vacuum connection

For EC-Servo screwdriver spindles		311E27-xxxx	311E36-0150	311E36-0300 311E36-0500
Handle	Part no.	425800E	425900F	425900G
Internal hex. drive DIN ISO 1173		F6.3	F6.3	F11.2

# Handle with integrated mouthpiece guide for the use in connection with an automatic feeder

For EC-Servo screwdriver spindles	311E27-xxxx	311E36-0150
Handle, Length of stroke 80 mm Part no.	4258001B	425900C
Handle, Length of stroke 100 mm Part no.	4258001C	425900D
Handle, Length of stroke 120 mm Part no.	4258001D	425900E

## Handle at side of spindle

For EC-Servo screv	wdriver spindles	311E42-xxxx
Handle	Part no.	1029831A

Screwdriver adapter

A grant adapter itus display (OK/NOT OK), an ergonomic start lever and an additional button for reversal or to start a screwdriving program. C can be adapted to a specific application by selecting the operat-ing mode. In this way for example the tool can be pre-programmed so that a second screwdriving program can be started directly by pressing the switch (e.g. a loosening program). Alternatively the mode can be selected so that the button is used for the pre-selection of the screwdriving program started via lever.

## Required Accessories for the use as handheld screwdrivers

For EC-Servo screwdriver spindles Weight of the screwdriver spindle	311E	311E27-xxxx 1.2 kg/2.64 lbs	311E36-xxxx 2.8 kg/6.16 lbs	311E42-xxxx 4.2 kg/9.24 lbs
<b>Linear stand</b> for torque reaction up to Weight of the horizontal arm	Part no. Nm/in.lbs kg/lbs	408010A 20/177 2/4.4	408010B 50/443 6.7/14.74	408010C 150/1328 13.7/30.14
Screwdriver adapter for the attachment to a linear stand (suitable for all handle variants)	Part. no.	4008333C	4008333B	102982A
Connection cable to AST40	Part. no.	385584A	385584A	385584A
Connection cable	Part. no	385584B	385584B	385584B



Screwdriver adapter 102982A

The suitable linear stands and balancers can be found in our brochure D3345E. In order to select the appropriate balancer please consider the weight of the horizontal arm, the weight of the screwdriver and additionally a mass of 1 kg for the screwdriver adapter and the handle. To split the weight we highly recommend to use 2 balancers.

Optional accessories for EC-Servo screw	driver spindles	311E27-xxxx	311E36-xxxx
Turn fixture	Part no.	917333A	on request
The rotary unit is integrated between the screwdrive ling is therefore guaranteed even on larger work sur		ndle and enables rotation of	the handle. Ergonomic hand
Please note: When using the rotary unit with the holder on the handle must be replaced by the holder	version of the ha	1 0	
0,	version of the ha	1 0	
holder on the handle must be replaced by the holde Support ring	version of the ha er part number 91 Part no.	7695 which must be ordered 398704A	d separately.
holder on the handle must be replaced by the holde	version of the ha er part number 91 Part no.	7695 which must be ordered 398704A	d separately.




Turn fixture 917333A




Support ring 398704A

Please note: when used as a handheld screwdriver only 3 screwdriving programs are available

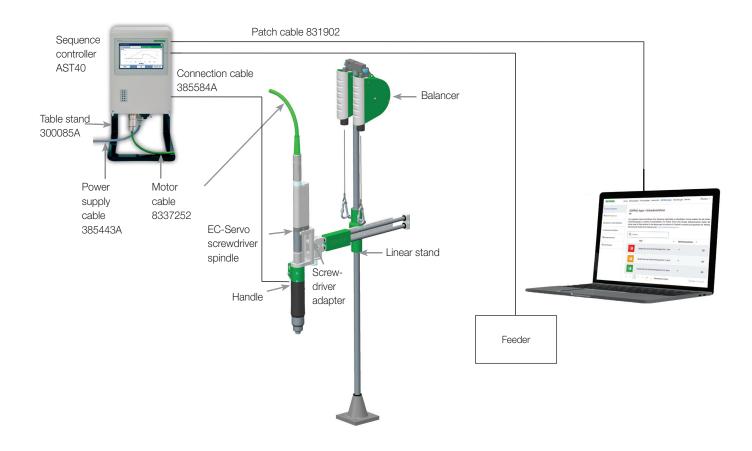

## SYSTEM OVERVIEW in connection with ASTi40

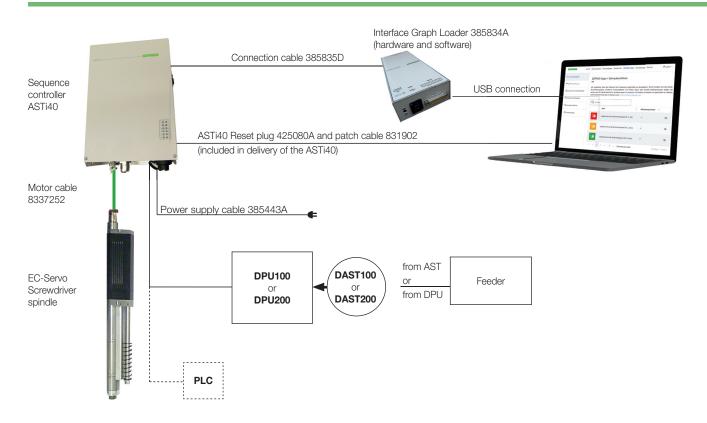

# SYSTEM OVERVIEW in connection with AST40


Sequence controller AST40 connected to the screwdriver via motor cable



supply cable



# **OVERVIEW INTERFACES of the AST40**

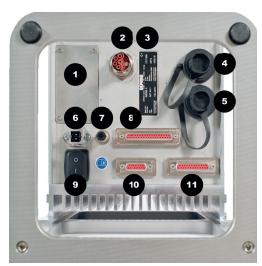

Bottom of the control

- 1 = fieldbus or printer interface (optional)
- 2 = motor cable connection
- 3 = type plate
- 4 = USB interface for system image generation
- 5 = Ethernet connection
- 6 = power supply
- 7 = 2-channel emergency stop
- 8 = I / O interface PLC 1
- 9 = on / off switch
- 10 = I / O interface PLC 3 (reload signal)
- 11 = I / O interface PLC 2

